

The Provision and Use of Work Equipment Regulations 1998, Regulation 6
 Work at Height Regulations 2005, Regulation 12

Name of User SOUTH HAMS DISTRICT COUNCIL
Location STAVERTON PLAY AREA, STAVERTON CRICKET GROUND, STAVERTON, TQ9 6PA

Policy No. NZ18364954 **Report No.** E35182017492 **Contract No.**

Item No. Inspection Dates: Last Current Next	Description Serial No. Make/Model Year of Manufacture Location	Configured Capacity or Operating Limit	A . Defects which could cause a danger to persons. Particulars of any repairs, renewals or alterations to rectify those defects and the time within which those defects shall be rectified. B . Identification of any other parts that require rectification C . Observations and Recommendations. (issues relating to health and safety. Any actions stipulated should be suitably and satisfactorily completed.)
P0 13-Sep-2018 18-Sep-2019 18-Sep-2020	Playground Site Survey STAVERTON CRICKET GROUND Play area		A None B One fence infill slat damaged/split at the pavilion pedestrian access gate adjoining fence. Two repair fence posts with metal sockets are loose in ground. One pavilion fence line mid fence post upper coach bolt nut is not fully seated. One perimeter fence post rotten and insecure located at the bottom end of the mini football pitch. C A suitable hard standing be provided at least 1 m either side of the access gate to prevent ground wear and trip hazards. The access gates be a conspicuous colour so as their location is easily identifiable. The play area access gates should open outwards away from the play area. A suitable clearance of between 60mm and 110 mm should be maintained underneath the bottom gate. The access gates close to fast, ideally the gate should not close quicker than 5 seconds. A suitable anti finger trapping clearance of 12mm should be provided between the access gates and posts. A suitable rubbish bin should be provided in the play area. Base of fence posts are being damaged by strimming. The newly created football pitch fence line is climbable and exhibits large gaps. Full details and guidance for play area fencing can be found on the ROSPA website.
P01 13-Sep-2018 18-Sep-2019 18-Sep-2020	Playground Equipment Item PLAYLINE WOODEN SWING SET Playline Wooden Swing Set Play Area		A None B Cradle seat rubber coating breaking up on upper structure. Bird mess on cradle seat. C The safety surface grass matting is buried in places which could affecting its efficiency and impact absorbing characteristics. You are advised to take advice from the safety surface manufacturer as to its correct in ground placement. Consideration be given to the fitment of swing barriers. A anti bird spike strip be fitted to the top of the swing set frame to stop bird mess on the seat.

Date of commencement of examination and tests 18-SEP-2019
 Date of Report 18-SEP-2019
 Engineer Surveyor

Competent Person
 Allianz Engineering
 UK Tel: +44(0) 1428 722407
 ROI Tel: +00353(0) 1 613 4081



Antony Jenkins



Report of Inspection

The Provision and Use of Work Equipment Regulations 1998, Regulation 6

Work at Height Regulations 2005, Regulation 12

Side 2 of 4

Report No. E35182017492

Item No. Inspection Dates: Last Current Next	Description Serial No. Make/Model Year of Manufacture Location	Configured Capacity or Operating Limit	A . Defects which could cause a danger to persons. Particulars of any repairs, renewals or alterations to rectify those defects and the time within which those defects shall be rectified. B . Identification of any other parts that require rectification C . Observations and Recommendations. (issues relating to health and safety. Any actions stipulated should be suitably and satisfactorily completed.)
P02 13-Sep-2018 18-Sep-2019 18-Sep-2020	Playground Equipment Item SUTCLIFFE SWB082 BENCH SEAT SWING SET Sutcliffe SWB082 Swing Set Play Area		A None B None C The safety surface grass matting is buried in places which could be affecting its efficiency and impact absorbing characteristics. You are advised to take advice from the safety surface manufacturer as to its correct in ground placement. Insufficient length of safety surface under item. Consideration be given to the fitment of swing barriers.
P04 13-Sep-2018 18-Sep-2019 18-Sep-2020	Playground Equipment Multi Activity Unit PLAYLINE WOODEN MAU Playline Wooden MAU Play Area		A None B One slat bridge Dee Shackle pin worn - located scramble net end of bridge. C The bridge hand rails should be infilled to prevent them from being used as a climbing frame. Rot starting in base of stepping blocks. Base of support posts are being damaged by strimming.
P05 Unknown 18-Sep-2019 18-Sep-2020	Playground Equipment Multi Activity Unit Earth Wrights Climber/ Platform/Slide Play area		A None B Insufficient length of grass mat impact surface at slide end and also missing at the sides to the end. Finger trap evident at the platform access hole edge batton - marked. Trapping point evident at one infill board to corner post -marked. Fall on hazard to climbing rope from platform access hole. Several log ends to the angled climber are unexpected obstructions. C The wood surfaces be treated with anti slip.
P06 Unknown 18-Sep-2019 18-Sep-2020	Playground Equipment Item Football Goals Play area		A None B None C Goal posts are home made.
P3 13-Sep-2018 18-Sep-2019 18-Sep-2020	Playground Equipment Item SUTCLIFFE SWS080 NEST SWING Sutcliffe SWS080 Nest Swing Play Area		A None B None C The safety surface grass matting is buried in places which could affecting its efficiency and impact absorbing characteristics. You are advised to take advice from the safety surface manufacturer as to its correct in ground placement. The enclosed nest seat suspension chains should be periodically exposed for internal examination and records of this made available for scrutiny.

The Provision and Use of Work Equipment Regulations 1998, Regulation 6
Work at Height Regulations 2005, Regulation 12
Side 3 of 4

Report No. E35182017492

The above items were seen at:
(If blank, refer to the location details)

Inspection carried out on behalf of: SOUTH HAMS DISTRICT COUNCIL
FOLLATON HOUSE
PLYMOUTH ROAD
TOTNES
TQ9 5NE

This report shall not be reproduced without the approval of Allianz Engineering and the Client for whom it was produced.

